

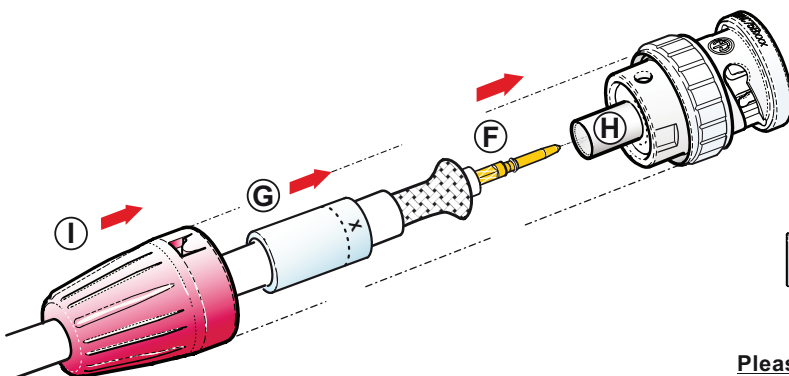
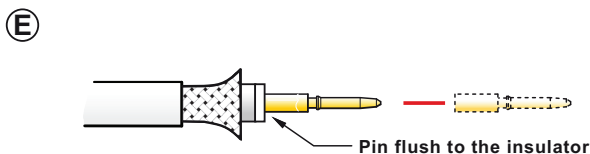
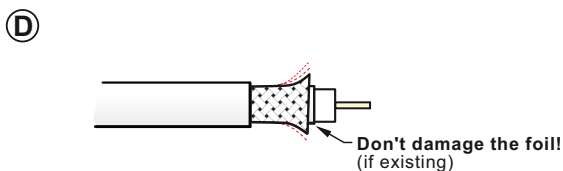


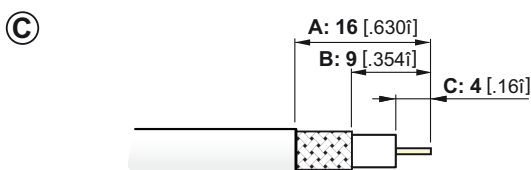


ASSEMBLY INSTRUCTION

Rear Twist BNC | 75Ω Cable Connector - Crimp version

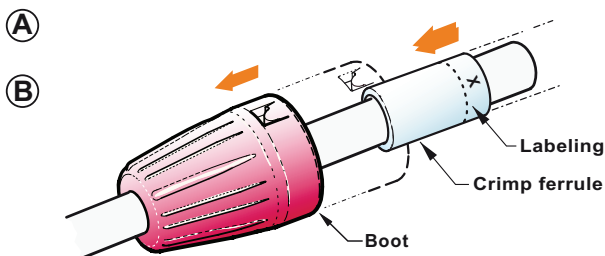


Assembled Connector

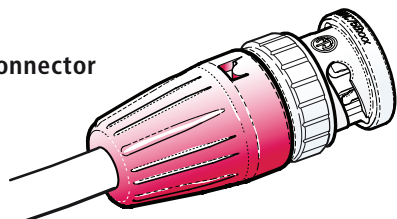

A Slide the boot onto the cable
- Position the labeling to the cabelend

B Slide the crimp ferrule onto the cable

C Prepare cable as shown
- Use an adjustable coaxial cable stripper

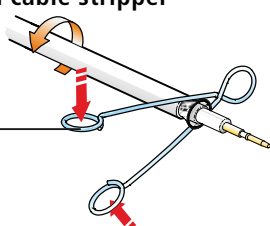D Spread the braided shield
(It's easily with the NEUTRIK® "SHIELD-SPREADING-TOOL"!) 

E Crimp the pin
- position the pin on the center conductor
- Crimp the pin with the tool
(For best crimping-results it is recommended to use the original Neutrik crimp tool
- HXBNC with the corresponding insert
or hexcrimp acc. to IEC 803-W (SW 1.7)
or squarecrimp acc. to IEC 803-2 (SW 1.6)
- Pin can also be soldered (Optional)!
- Straighten the pin if misaligned.

F Insert the cable into the connector body

G Slide the crimp ferrule over the shield to the front and push the cable and leading ferrule to its end position until you hear a snap noise.

Please note:
Position the connector body
Flush with the die face.

H Crimp the ferrule with the tool

(For best crimping-results it is recommended to use the original Neutrik tool - HXBNC with the corresponding insert)

I Snap the boot onto the connector body

NEUTRIK AG
NEUTRIK Z_ rich AG
NEUTRIK USA Inc.
NEUTRIK (UK) Ltd.

LI
CH
USA
UK

T: +423 / 237 24 24 F: +423 / 232 53 93
T: +41 44 / 736 5010 F: +41 44 / 736 5011
T: +1 732 / 901 9488 F: +1 732 / 901 9608
T: +44 1983 / 811 441 F: +44 1983 / 811 439

NEUTRIK Vertriebs GmbH
NEUTRIK France
NEUTRIK Tokyo Ltd.
NEUTRIK Hong Kong Ltd.

DE/NL/AT
FR
JP
HK

T: +49 8131 / 280 890 F: +49 8131 / 280 830
T: +33 1 / 4131 6750 F: +33 1 / 4131 0511
T: +81 3 / 3663 4733 F: +81 3 / 3663 4796
T: +852 / 2687 6055 F: +852 / 2687 6052